

6. 交換部品 / オプション

● 交換部品

品番	部品名	仕様
AS5000	センサー / 鉛フリー対応 校正付き	

● オプション

品番	部品名	仕様
A1310	温度プローブ / はんだ槽用	
C1541	温度プローブ / ホットエア用	センサー A・B 付き
CX1002	温度プローブ / 自動機用	
A1556	センサー A	
A1557	センサー B	

※ センサーを外し、温度プローブのコネクターの赤、青の色を合わせて、測定器本体のターミナルに差し込みます。

6. 更換部件 / 選購部品

● 更換部件

編號	部件名稱	規格
AS5000	傳感器 / 可對應無鉛焊錫 具備 COC 符合性證明書	

● 選購部品

編號	部件名稱	規格
A1310	溫度探測針 / 焊錫槽用	
C1541	溫度探測針 / 熱風用	附傳感器 A / B
CX1002	溫度探測針 / 機械人用	
A1556	傳感器 A	
A1557	傳感器 B	

* 將傳感器拆下，再把探針連接部的紅色對紅色終端，藍色對藍色終端連接到測試儀機身。

6. REPLACEMENT PARTS AND OPTIONS

● Replacement Parts

Item No.	Part Name	Specifications
AS5000	Sensor/lead-free with certificate of conformance	

● Options

Item No.	Part Name	Specifications
A1310	Temperature probe/soldering pot	
C1541	Temperature probe/hot air	with sensor A/B
CX1002	Temperature probe/robot	
A1556	Sensor A	
A1557	Sensor B	

* Remove the sensor, and connect the red connector of this option to the red terminal of the thermometer and the blue connector to the blue terminal.



白光株式会社

https://www.hakko.com

〒556-0024 大阪市浪速区草塚2丁目4番5号
TEL: (06) 6561-1574 (代) FAX: (06) 6568-0821



HAKKO CORPORATION

HEAD OFFICE

4-5, Shiokusa 2-chome, Naniwa-ku, Osaka 556-0024 JAPAN
TEL: +81-6-6561-3225 FAX: +81-6-6561-8466
https://www.hakko.com E-mail: sales@hakko.com

OVERSEAS AFFILIATES

U.S.A.: AMERICAN HAKKO PRODUCTS, INC.

TEL: (661) 294-0090 FAX: (661) 294-0096
Toll Free (800) 88-HAKKO

https://www.hakkoUSA.com E-mail: Support@HakkoUSA.com

HONG KONG: HAKKO DEVELOPMENT CO., LTD.






TEL: 2811-5588 FAX: 2590-0217
https://www.hakko.com.cn E-mail: info@hakko.com.hk

SINGAPORE: HAKKO PRODUCTS PTE., LTD.

TEL: 6748-2277 FAX: 6744-0033
https://www.hakko.com.sg E-mail: sales@hakko.com.sg

Please access the web address below for other distributors.

https://www.hakko.com

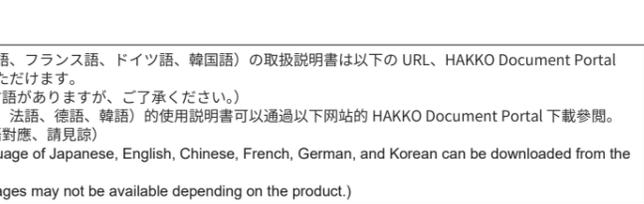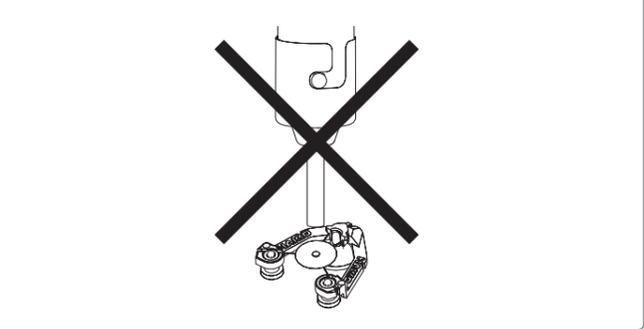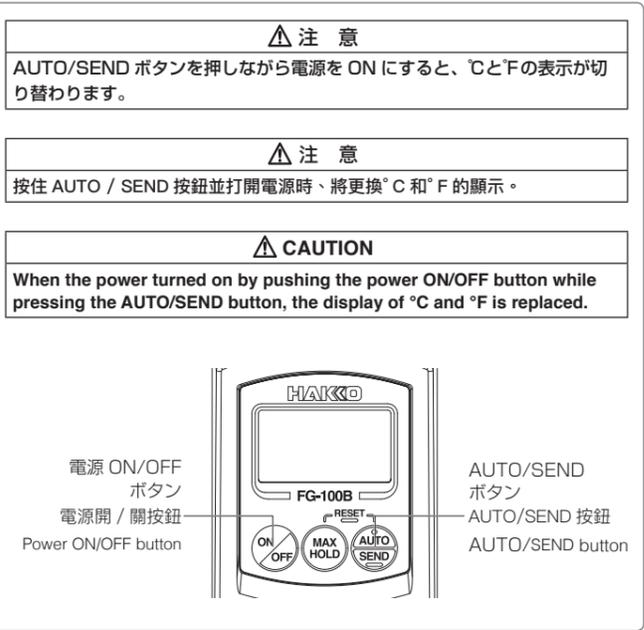

https://doc.hakko.com

中國 RoHS: 產品中有毒有害物質或元素的名稱及含量						
部件名稱	有毒有害物質或元素					
	鉛 (Pb)	汞 (Hg)	鎘 (Cd)	六價鉻 (Cr(VI))	多溴聯苯 (PBB)	多溴二苯醚 (PBDE)
曲柄	×	○	○	○	○	○
上蓋	×	○	○	○	○	○
電路板	×	○	○	○	○	○

○: 表示該有毒有害物質在該部件所有均質材料中的含量均在 SJ/T 11363-2006 標準規定的限量要求以下。
×: 表示該有毒有害物質至少在該部件的某一均質材料中的含量超出 SJ/T 11363-2006 標準規定的限量要求。



2020.7
MA03190XZ200728

HAKKO

THERMOMETER


FG-100B

取扱説明書

このたびはハッコー FG-100B をお買い上げいただき、まことにありがとうございます。
本製品は、はんだこてのごて先等の温度を測定する温度計です。
お使いになる前に必ず本書をお読みください。
お読みになった後は、いつでも見られるようお手元に大切に保管しておいてください。

1. セット内容と各部名称

最初にセットの内容をご確認ください。
ハッコー FG-100B.....1 センサー.....1
006P 9V 乾電池 (お試用).....1 取扱説明書.....1

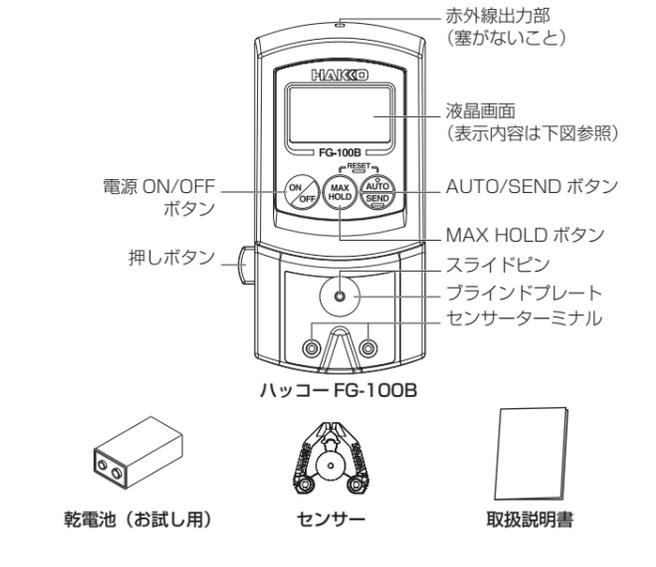

- ※ 1 センサーが切れるとバーンアウト表示になります。その時は新しいセンサーと交換してください。
- ※ 2 電池が消耗している時に「B」が表示されます。正確な温度を出すために、必ず新しい電池と交換してください。
- ※ 3 カウント数をリセットする時は「MAX」ボタンと「CAL」ボタンを同時に長く (1 秒以上) 押ししてください。

2. 仕様


タイプ	°C	°F
品名	ハッコー FG-100B	
分解能	1°C	1°F
測定温度範囲	0 ~ 700°C *1	32 ~ 1,300°F *1
適用センサー	K (CA) 熱電対	
測定許容差	±3°C (300 ~ 600°Cの範囲)	±6°F (572 ~ 1,112°Fの範囲)
	±5°C (その他の温度範囲)	±10°F (その他の温度範囲)
電源 (電池)	006P 9V 乾電池 (アルカリ乾電池推奨)	
外形寸法	75 (W) × 44 (H) × 140 (D) mm	
重量	125 g (電池除く)	
動作環境	使用温度 / 湿度範囲: 0 ~ 40°C, 80% RH 最大 (結露なきこと)	
環境条件	適用定格汚染度 2 (IEC/UL 61010-1 による)	

※ 1 センサーの使用は、500°C (932°F) までです。
500°C (932°F) 以上の測定を行う時は温度プローブ (「6. 交換部品 / オプション」参照) 使用ください。


改良の為、予告なしに仕様を変更することがあります。

3. 安全及び取扱い上のご注意


安全のため以下の注意事項を必ず守ってください。

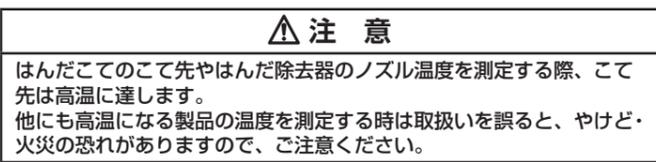


4. 使用方法




1. ハッコー FG-100B 背面の電池フタを開け、正しい方向に電池を入れます。
2. 付属のセンサーを取り付けます。

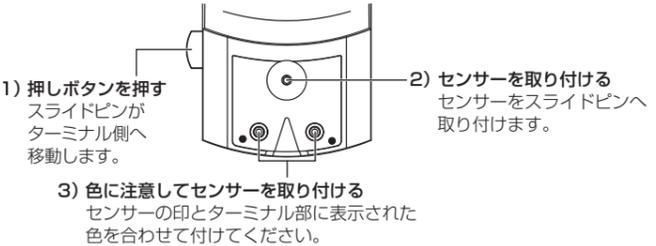

3. センサーを取り付けたら電源を入れます。室温が表示されたら測定可能です。



4. こて先に新しいはんだをのせて、センサーの測温部に正確に当ててください。

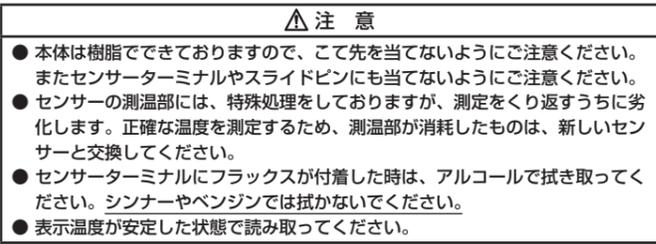

5. 各ボタンの機能と操作方法

- オートシャットオフ機能
電源を入れた状態で、100°C以上の温度が計測されないまま約3分が経過すると、自動的に電源がOFFになります。3分以内に100°C以上の温度が計測されると、3分延長されます。
- MAX HOLD 機能
「MAX HOLD」ボタンを短く (1 秒未満) 押し、画面右下に「MAX HOLD」と表示されます。MAX 温度更新機能がONになり、常に最大値を表示します。
「MAX HOLD」ボタンは、他に下記の機能があります。
 - 「MAX HOLD」と表示された状態で、「MAX HOLD」ボタンを短く (1 秒未満) 押し、更新された最大値の温度を表示します。
 - 「MAX HOLD」と表示された状態で、「MAX HOLD」ボタンを長く (1 秒以上) 押し、MAX HOLD 機能が解除され、通常表示に戻ります。
- AUTO HOLD 機能
「MAX HOLD」ボタンを短く (1 秒未満) 押し、画面右下に「AUTO」と点滅表示されます。この状態でこて先をセンサーの側温部にて、こて先温度の平均値を読み取って算出します。平均値算出が完了すると「AUTO」が点灯に切り替わり、算出結果が固定表示されます。
「MAX HOLD」ボタンを短く押したびに、AUTO HOLD 機能がONとOFFに切り替わります。正しく測定できない恐れがありますので、温度プローブを使用した測定でAUTO HOLD 機能は使用しないでください。

- 温度送信機能
「MAX HOLD」ボタンを長く (1 秒以上) 押し時ハッコーFG-100B上部の赤外線出力部より、温度データが送信されます。送信中は温度表示が点滅します。温度送信機能は受信できる機器のみに送信できます。固定表示された値のみ送信できます。

THERMOMETER

FG-100B

使用說明書

日本白光牌

承蒙惠顧，謹致謝忱。

使用 HAKKO FG-100B 前，請詳閱本使用說明書，正確使用。
並請於閱讀之後小心保管以便日後使用。

1. 包裝清單及各部名稱

首先請確認包裝內容。

HAKKO FG-100B1 傳感器1
006P 9V 乾電池 (試用電池)1 使用說明書1



- *1 傳感器斷裂時，會顯示傳感器損壞。請更換新的傳感器。
- *2 如果顯示 **B** 表示乾電池含量不夠，不能正確測量溫度，必須更換新的乾電池。
- *3 在使計數復位的時候，同時做長按 **MAX** 和 **AUTO** 按鈕。

2. 規格

型	攝氏型	華氏型
型號	HAKKO FG-100B	
分解	1°C	1°F
量度範圍	0 ~ 700°C ^{*1}	32 ~ 1,300°F ^{*1}
傳感器	K (CA) 熱電偶	
測定容許差	±3°C (範圍 300 ~ 600°C)	±6°F (範圍 572 ~ 1,112°F)
	±5°C (其他溫度範圍)	±10°F (其他溫度範圍)
電源 (電池)	006P 9V 乾電池 (推薦: 鹼性乾電池)	
外部尺寸	75 (W) × 44 (H) × 140 (D) mm	
重量	125 g (不包含電池)	
運作環境	使用溫度 / 濕度範圍: 0 - 40°C、max.80% RH (無凝結)	
環境條件	適用規格污染度 2 (基於 IEC/UL61010-1)	

*1 傳感器是可以使用至 500°C (932°F)。
如果測定 500°C (932°F) 以上時 請使用溫度探針 (請參照「6. 更換部件 / 選購部品」)。

規格及外觀有可能改良變更，恕不另行通知。

3. 安全及使用上的注意事項

為安全起見，請嚴格遵守“注意事項”。

注意


測量焊鐵的焊鐵頭和除錫器的吸嘴溫度時，由於溫度會高達 200 ~ 450°C，必須小心處理。
濫用可能會導致灼傷或火患，請注意。

4. 使用方法

注意

傳感器是用非常纖細 (直徑 0.2) K (CA) 型熱電偶制成，宜小心使用，切勿擠壓，否則會導致斷裂。

1. 打開電池蓋，按正確的方向放入電池。
2. 安裝附帶的傳感器。

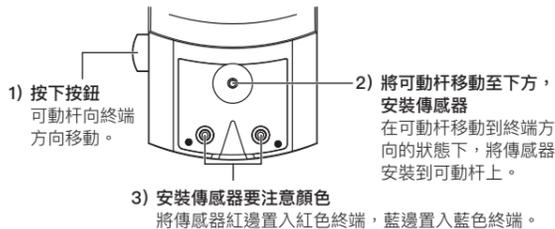

3. 傳感器安裝完畢後打開電源開關。當顯示屏顯示室溫時，溫度計便可使用。

一 注 記 一

- 按電源開關的時間太短，可能無法打開。請長按電源開關。
- 電源打開後的液晶顯示全部點亮時，電源無法立即關閉。

4. 請在焊鐵頭上放上新的焊錫，使用焊鐵頭觸及傳感器的測量點。

注意

- 溫度計本身是用塑料制成，請注意不要用焊鐵頭觸及。另外請注意也不要讓焊鐵頭碰觸終端和可動杆。
- 儘管傳感器的測溫部進行過特殊處理，但反覆測定會逐漸劣化。為了能夠正確測定溫度，如果測定點損壞後，請更換新的傳感器。
- 終端上粘附了助焊劑時，請用酒精擦拭。請不要用稀釋劑和汽油擦拭。
- 請於溫度的顯示狀態安定後辨識。

5. 各按鈕的功能和操作方法

- **自動關閉功能**
電源打開後，如果 3 分鐘以內沒有測試 100°C 以上的溫度的話，電源會自動關閉。3 分鐘以內有測試 100°C 以上的溫度的話，液晶顯示會延長 3 分鐘。

- **MAX HOLD 功能**
按下 **MAX HOLD** 按鈕 (小於 1 秒)，畫面下方則顯示“MAX HOLD”。MAX 溫度更新功能打開，最大值始終顯示。
- **MAX HOLD 按鈕另有以下功能**
 - 顯示“MAX HOLD”時，按下按鈕 (小於 1 秒) 將顯示更新為最高溫度。
 - 顯示“MAX HOLD”時，長按按鈕 (1 秒或更長時間) 會釋放 MAX HOLD 功能並返回正常顯示。

- **AUTO HOLD 功能**
按下 **AUTO** 按鈕 (小於 1 秒) 後，畫面右下會閃滅顯示“**AUTO**”。在此狀態下將焊鐵頭接觸傳感器，讀取焊鐵頭溫度的平均值後算出。平均值算出後“**AUTO**”轉為點亮狀態，會固定顯示出算出結果。每按下按鈕，AUTO HOLD 功能會進行 ON 和 OFF 的切換。AUTO HOLD 功能沒正假定在熱風機的溫度探測器的測量。

- **發送溫度功能**
AUTO 按鈕長時間 (1 秒以上) 按下時通過 HAKKO FG-100B 上部的紅外線輸出發送溫度數據。通信中的溫度顯示會閃滅。溫度發送功能只在能接收的機器能發信。只表示被固定的值能發信。

THERMOMETER

FG-100B



Instruction Manual

Thank you for purchasing the HAKKO FG-100B thermometer.
Please read this manual before operating the HAKKO FG-100B.
Please keep this manual readily accessible for reference.

1. PACKING LIST AND PART NAMES

Please check to make sure that all items listed below are included in the package.

HAKKO FG-100B.....1 Sensor1
006P 9V Dry battery (For trial)1 Instruction manual.....1

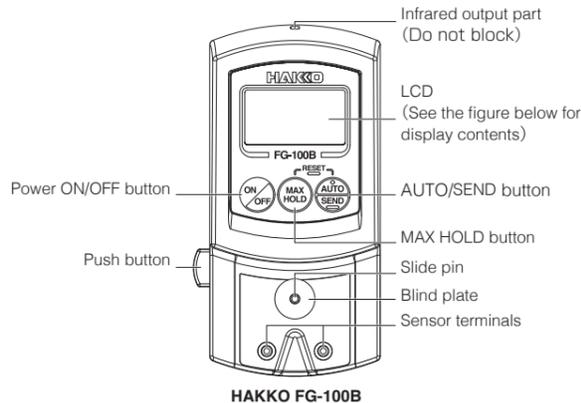

- *1 This alarm indicates a sensor burnout. If this alarm occurs, replace the sensor.
- *2 When **B** appears, be sure to replace the battery. Failure to do so will result in incorrect temperature measurements.
- *3 When pressing the **MAX HOLD** and **AUTO** button for longer, the count is reset.

2. SPECIFICATIONS

Type	Celsius type	Fahrenheit type
Model name	HAKKO FG-100B	
Resolution	1°C	1°F
Temperature measurement range	0 - 700°C ^{*1}	32 - 1,300°F ^{*1}
Applicable sensor	K (CA) type thermocouple	
Measurement tolerance	±3°C (between 300 and 600°C)	±6°F (between 572 and 1,112°F)
	±5°C (Other than above)	±10°F (Other than above)
Power supply	006P 9V dry battery (alkaline cell recommended)	
Outline dimensions	75 (W) × 44 (H) × 140 (D) mm	
Weight	125 g (excluding battery)	
Operating environment	Ambient Temperature/Humidity Range: 0 to 40°C (32 to 104°F), max.80% RH (without condensation)	
Environmental conditions	Applicable rated pollution degree 2 (according to IEC/UL61010-1)	

*1 Sensor can only be used to measure temperatures below 500°C (932°F). To measure higher temperatures, use an applicable temperature probe (see “6. REPLACEMENT PARTS AND OPTIONS”).

The specifications may be subject to change without notice.

3. SAFETY NOTICE

CAUTION


When using the thermometer to measure the temperature of the soldering iron tip or desoldering nozzle, pay great attention to the temperature of the tip or nozzle that will be as high as 200 to 450°C (392 to 842°F). Careless handling of such a hot object may result in a burn or fire.

4. OPERATION

CAUTION

Handle the sensor with care. Inadvertent handling may break the K (CA) type thermocouple as it is as thin as 0.2 mm in diameter.

1. Open the battery cover and insert the battery in the correct direction.
2. Attach the sensor:

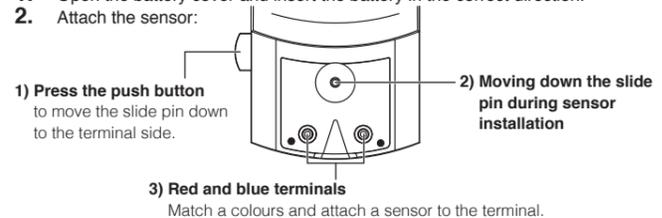

3. Turn on the power. When the room temperature appears on the LCD, the thermometer is ready for measurement.

NOTE

- Pressing the power button for a short duration may result in failure to turn on the power. In such a case, press the button again for a longer duration.
- The power cannot be turned off until all screen elements are displayed after the power is turned on.

4. Wet the soldering iron tip with solder and put the tip to the measuring point.

CAUTION

- Do not bring the hot iron tip into contact with the plastic body, slide pin and terminals of the thermometer. Doing so will damage them.
- Although the measurement point of the sensor undergoes special treatment, it will deteriorate gradually due to repeated measurements. In order to measure the temperature correctly, if the measurement point is worn out, replace the sensor with a new one.
- If the terminals are contaminated with the soldering flux, wipe them clean with alcohol. Do not use thinner or benzoin for cleaning.
- Please read when the temperature stabilizes.

5. FUNCTION AND OPERATION OF EACH BUTTON

- **Auto shutoff function**
If no measurement is taken within three minutes after power on, the power will be turned off automatically. Measurement of a temperature higher than 100°C (212°F) within three minutes will reset the auto shutoff. To turn on the power, press the power button again.

- **MAX HOLD function**
When quickly pressing the **MAX HOLD** button (less than 1 second), “MAX HOLD” is displayed at the lower of the screen. As long as “MAX HOLD” appears, the maximum temperature will stay displayed

- The **MAX HOLD** button has the following other functions.
 - When “MAX HOLD” is displayed, quickly pressing the **MAX HOLD** button (less than 1 second) displays the updated maximum temperature.
 - When “MAX HOLD” is displayed, pressing the button for longer (1 second or longer) releases the MAX HOLD function and returns to normal display.

- **AUTO HOLD function**
When quickly pressing the **AUTO** button, “**AUTO**” blinks at the lower right of the LCD. While “**AUTO**” blinks, touch the soldering iron tip to the sensor. After detecting the stabilization of the temperature of the tip, the average temperature will be calculated. After the average value has been calculated, “**AUTO**” will stop blinking and stay lit, and the calculation result will be displayed.

- **Temperature sending function**
Press the **AUTO** button for longer than one second. Temperature data will be sent by infrared output from the upper part of the thermometer. Temperature display blinks during sending. The temperature sending function can only send messages to the receiving machine. When the fixed value can be sent.